

Specifications

Model	Line Voltage (VAC)	Armature Voltage Range (VDC)	Continuous Armature Current (Amps)	Armature Horsepower Range
RGF403-25	115 230	0 - 90 0 - 180	25.0	1 - 2 1/2 1 - 5

AC Line Voltage.....115/230 VAC $\pm 10\%$, 50/60 Hz, single phase
Form Factor.....1.37 at base speed
Field Voltage with 115 VAC line voltage.....50 or 100 VDC
with 230 VAC line voltage.....100 or 200 VDC
Maximum Field Current......3 Amp
Acceleration Time Range......0.5 - 8 seconds
Deceleration Time Range......0.5 - 8 seconds
Analog Input Voltage Range.....0 to ± 25 , 0 to ± 250 VDC
Current Range.....1 - 5, 4 - 20, 10 - 50 mA
Input Impedance Voltage Signal (0 to ± 25 VDC).....25K ohms
Voltage Signal (0 to ± 250 VDC).....125K ohms
Current Signal (1-5 mA)......1K ohms
Current Signal (4-20 mA)......235 ohms
Current Signal (10-50 mA)......100 ohms
Load Regulation with Armature Feedback......1% base speed
with Tachogenerator Feedback......0.1% base speed
Speed Range with Armature Feedback.....50:1
with Tachogenerator Feedback.....60:1
Vibration (0 - 50 Hz)......0.5G maximum
(>50 Hz)......0.1G maximum
Ambient Temperature Range
When mounted flat (horizontally) or in an enclosure whose volume is between 5 and 8 cubic feet.....10°C - 40°C
When mounted upright (vertically) or in an enclosure whose volume is greater than 8 cubic feet.....10°C - 50°C
Weight.....4.6 lbs
Safety Certifications.....UL/cUL Listed Equipment, file # E132235


Drive Model	Short Circuit Current Rating		Types of Branch Circuit Protection		Maximum Rating of Overcurrent Protection
	Maximum Current, A	Maximum Voltage, V	Non-time Delay KS Fuse	Inverse Time Circuit Breaker	
RGF403-25	10,000	240 V			30 A

Safety Warnings

READ ALL SAFETY WARNINGS BEFORE INSTALLING THIS EQUIPMENT

- DO NOT INSTALL, REMOVE, OR REWIRE THIS EQUIPMENT WITH POWER APPLIED.** Have a qualified electrical technician install, adjust and service this equipment. Follow the National Electrical Code and all other applicable electrical and safety codes, including the provisions of the Occupational Safety and Health Act (OSHA), when installing equipment.
- Circuit potentials are at 115 or 230 VAC above earth ground.** Avoid direct contact with the printed circuit board or with circuit elements to prevent the risk of serious injury or fatality. Use a non-metallic screwdriver for adjusting the calibration trim pots. Use approved personal protection equipment and insulated tools if working on this drive with power applied.
- Reduce the chance of an electrical fire, shock, or explosion by using proper grounding techniques, over-current protection, thermal protection, and enclosure. Follow sound maintenance procedures.
- ACE strongly recommends the installation of a master power switch in the line voltage input.** The switch contacts should be rated for 250 VAC and 200% of motor nameplate current.
- Removing AC line power is the only acceptable method for emergency stopping.** Do not use regenerative braking, decelerating to minimum speed, or coasting to a stop for emergency stopping. They may not stop a drive that is malfunctioning. Removing AC line power is the only acceptable method for emergency stopping.
- Line starting and stopping (applying and removing AC line voltage) is recommended for infrequent starting and stopping of a drive only. Regenerative braking, decelerating to minimum speed, or coasting to a stop is recommended for frequent starts and stops. Frequent starting and stopping can produce high torque. This may cause damage to motors.
- Do not disconnect any of the motor leads from the drive** unless power is removed or the drive is disabled. Opening any one lead while the drive is running may destroy the drive.
- The field output is for shunt wound motors only. Do not make any connections to F1 and F2 when using a permanent magnet motor.
- Change voltage switch settings only when the drive is disconnected from AC line voltage. Make sure both switches are set to their correct position. If the switches are improperly set to a lower voltage position, the motor will not run at full voltage and may cause damage to the transformer. If the switches are improperly set to a higher voltage, the motor will overspeed, which may cause motor damage, or result in bodily injury or loss of life.
- Under no circumstances should power and logic level wires be bundled together.
- Be sure potentiometer tabs do no make contact with the potentiometer's body. Grounding the input will cause damage to the drive.
- This product does not have internal solid state motor overload protection. It does not contain speed-sensitive overload protection, thermal memory retention, or provisions to receive and act upon signals from remote devices for over temperature protection. If motor protection is needed in the end-use product, it needs to be provided by additional equipment in accordance with NEC standards.

Dimensions

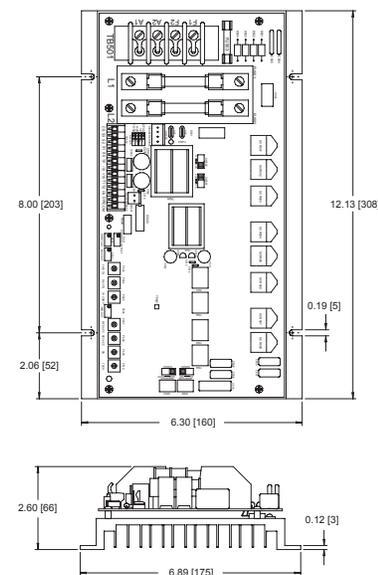

ALL DIMENSIONS IN INCHES [MILLIMETERS]

Connections

POWER

Line Input
Connect the AC line power leads to terminals L1 and L2, or to a double-throw, single-pole master power switch (recommended). The switch should be rated at a minimum of 250 VAC and 200% of motor current.

Motor
Connect the DC armature leads to terminals A1 and A2. If the motor does not spin in the desired direction, power down the drive and reverse these connections.

Field
At 115 VAC, connect the field leads to terminals F1 and L1 for a 50 VDC field or to F1 and F2 for a 100 VDC field. At 230 VAC, connect the field leads to terminals F1 and L1 for a 100 VDC field or to F1 and 2 for a 200 VDC field. **Do not make any connections to F1 and F2 if using a permanent magnet motor.**

LOGIC

Speed Potentiometer
Use a 10K ohm, 1/4 W potentiometer for speed control. Connect the counter-clockwise end of the potentiometer to S0, wiper to S2, and the clockwise end to S1. If the potentiometer works inversely of desired functionality, (i.e. to increase motor speed, you must turn the potentiometer counter-clockwise), power off the drive and swap the S0 and S1 connections. See the Operation section for alternative wiring setups.

Analog Input Signal Range
Instead of using a speed adjust potentiometer, the RGF403 series drive may be wired to follow an analog input signal. This input signal can be in the form of voltage (0 ± 250 VDC) or current (1 - 5, 4 - 20, 10 - 50 mA). Because these drives have built in isolation, the input signal can be grounded or ungrounded (floating). Connect the analog common to S0. If using an analog current signal, connect the analog reference to CS. If using an analog voltage range smaller than 0 ± 25 VDC, connect the analog reference to S2. If using a voltage range larger than 0 ± 25 VDC, connect the analog reference to HV.

LOGIC

Inhibit (Regenerative Brake)
Short the REGEN terminals to regeneratively brake the motor to zero speed. The REGEN BRAKE terminals bypass the FWD ACC and REV ACC trim pots. Open the REGEN BRAKE terminals to accelerate the motor to set speed. ACE offers two accessory plug harnesses for connecting to the REGEN BRAKE terminals; part number KTW-0001 [18 in (46 cm) leads] and part number KTW-0002 [36 in (91 cm) leads]. **Do not use the inhibit / regen brake for emergency stopping.**


Regenerative Brake
Short terminals RB1 and RB2 to regeneratively brake the motor to zero speed. The regenerative brake circuitry follows the FWD ACC and REV ACC trim pots. Open terminals RB1 and RB2 to accelerate the motor to set speed. **Do not use the regenerative braking for emergency stopping.**

Enable
Short pins 2 and 3 on terminal S0S02 to coast the motor to zero speed. Short pins 3 and 4 on terminal S0S02 to accelerate the motor to set speed. If no Enable switch is desired, jumper pins 3 and 4 on S0S02 (factory default). ACE offers an accessory plug harness for connecting to the enable terminals; part number KTW-0004 [18 in (46 cm) leads]. **Do not use the enable for emergency stopping.**

Tachogenerator
Using tachogenerator feedback improves speed regulation from approximately 1% of motor base speed to 0.1% of motor base speed. Use tachogenerators rated from 7 VDC per 1000 RPM to 50 VDC per 1000 RPM. Connect the tachogenerator to terminals T1 (positive) and T2 (negative).

+15 and -15
RGF series drive can supply a regulated +15 and -15 VDC voltage (each sourcing 25 mA maximum) with respect to RB1 or T1 to isolated, external devices.

Direction
Short terminals DIR and COM to change the direction of the motor. If no direction switch is desired, leave this connection open.

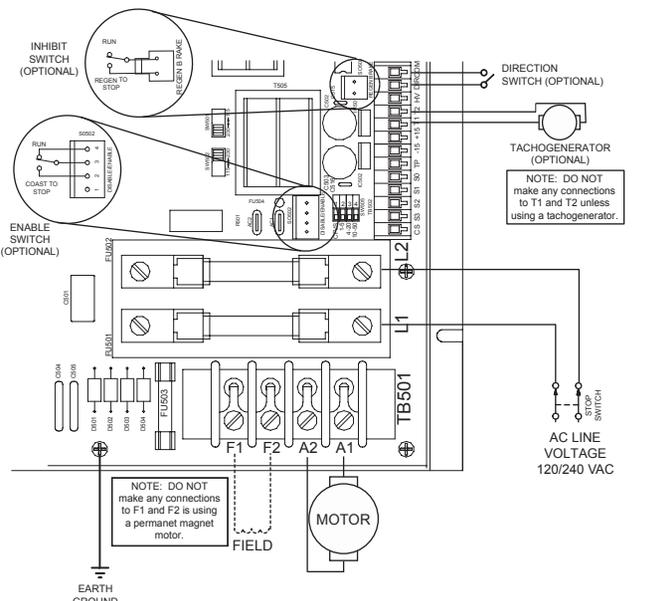

Installation

Mounting

- Drive components are sensitive to electrostatic discharge. Avoid direct contact with the circuit board. Hold the drive by the heat sink only.
- Protect the drive from dirt, moisture, and accidental contact.
- Provide sufficient room for access to the terminals and calibration trim pots.
- Mount the drive away from heat sources. Operate the drive within the specified ambient operating temperature range.
- Prevent loose connections by avoiding excessive vibration of the drive.
- Mount the drive with its board in either a horizontal or vertical plane. Four 0.19" (5 mm) wide slots in the heat sink accept #8 pan head screws. Fasten either the large base or the narrow flange of the chassis to the subplate.
- The heat sink should be earth grounded. Use a star washer beneath the head of at least one of the mounting screws to penetrate the anodized heat sink surface and to reach bare metal.

Wiring

Use 18 - 24 AWG wire for logic wiring. Use 14 - 16 AWG wire for AC line and motor wiring.

Shielding Guidelines

As a general rule, it is recommended to shield all conductors. If it is not practical to shield power conductors, it is recommended to shield all logic-level leads. If shielding of logic-level leads is not practical, the user should twist all logic leads with themselves to minimize induced noise. It may be necessary to earth ground the shielded cable. If noise is produced by devices other than the drive, ground the shield at the drive end. If noise is generated by the drive, ground the shield at the end away from the drive. Do not ground both ends of the shield.

Fusing

The drive provides on board fusing for the AC line (L1, L2). Fuses are rated for 40A at 480 VAC.

Startup

SELECT SWITCHES

Input Voltage Select (SW501, SW502)

Set the voltage switches SW501 and SW502 to either 115 or 230 to match the AC line voltage.

Armature Voltage Select (SW503)


Set the voltage select SW502 to either 90 or 180 to match the maximum armature voltage.

Feedback Select (SW504)

Set the feedback select switch SW504 to either ARM for armature feedback or TACH for tachogenerator feedback.

Signal Select (SW505)

Set the signal select switch SW505 to the corresponding input signal. Set all DIP switches ON when a speed adjust potentiometer is used. Set only DIP switch 1 (CFVS) ON when a voltage input signal is used. Set only DIP switch 2 ON when a 1-5 mA current input signal is used. Set only DIP switch 3 ON when a 4-20 mA current input signal is used. Set only DIP switch 4 ON when a 10-50 mA current input signal is used.

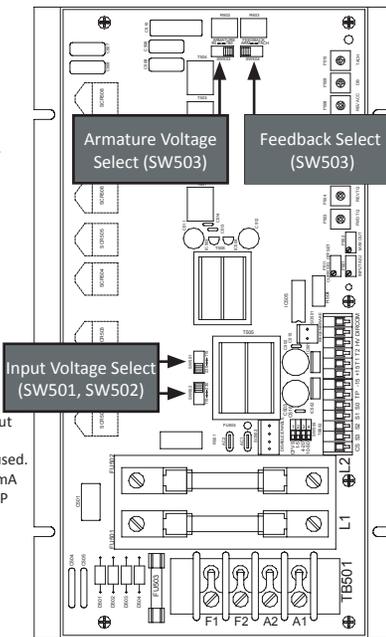

STARTUP

- Verify that no foreign conductive material is present on the printed circuit board.
- Ensure that all switches are properly set.

1. Turn the speed adjust potentiometer full counterclockwise (CCW) or set the analog input voltage or current signal to minimum.
2. Apply AC line voltage.
3. Enable the drive if using an enable switch on SO502. Otherwise, make sure the jumper is in place.
4. Slowly advance the speed adjust potentiometer clockwise (CW) or increase the analog input voltage or current signal. The motor slowly accelerates as the potentiometer is turned CW or as the analog input voltage or current signal is increased. Continue until the desired speed is reached.
5. Remove AC line voltage from the drive to coast the motor to a stop.

Current Signal Offset (CURR SIG OFFSET): The CURR SIG OFFSET setting offsets any drifting the motor may experience when using a current signal input. The trim pot is factory set and should not need adjustment. Do not adjust this trim pot unless you are experiencing drift problems. To calibrate the CURR SIG OFFSET:

1. Ensure that the input power is off.
2. Set the current input signal to zero.
3. Set the CURR SIG OFFSET trim pot to the approximate midrange (25 turn trim pot).
4. Apply power and observe the motor shaft.
5. If the motor shaft drifts, or slowly rotates with no signal applied, adjust the CURR SIG OFFSET trim pot until the motor shaft stops. The direction and amount of trim pot adjustment depends on the direction of shaft rotation and connection of the motor leads.

Input Adjust (INPUT ADJ): The INPUT ADJ setting scales the input signal. To calibrate the INPUT ADJ:

1. Verify the SW505 is properly set. See the Startup section for settings.
2. If using a voltage input signal, set the INPUT ADJ trim pot to the approximate midrange (25 turn trim pot).
3. Apply the minimum input voltage or current signal.
4. Adjust the MIN OUT trim pot until the motor runs at the desired minimum speed.
5. Apply the maximum input voltage or current signal.
6. Adjust the MAX OUT trim pot until the motor runs at the desired maximum speed.
7. If a higher maximum speed is desired, re-adjust the INPUT ADJ trim pot CW.
8. Repeat steps 3 through 7 until no further recalibration is necessary.

Calibration

Minimum Speed (MIN OUT): The MIN OUT setting determines the minimum motor speed when the speed adjust potentiometer is set for minimum speed. It is factory set for zero speed. The minimum speed applies only when the drive is operating in unidirectional mode. To calibrate the MIN OUT:

1. Set the MIN OUT trim pot full CCW.
2. Set the speed adjust potentiometer for minimum speed.
3. Adjust MIN OUT until the desired minimum speed is reached or is just at the threshold of rotation.

Maximum Speed (MAX OUT): The MAX OUT setting determines the maximum motor speed when the speed adjust potentiometer is set for maximum speed. It is factory set for maximum rated motor speed. To calibrate the MAX OUT:

1. Set the MAX OUT trim pot full CCW.
2. Set the speed adjust potentiometer for maximum speed.
3. Adjust MAX OUT until the desired maximum speed is reached.

Forward Torque (FWD TQ) and Reverse Torque (REV TQ): The FWD TQ and REV TQ settings determine the maximum torque for accelerating and driving the motor in the forward and reverse direction.

To calibrate the FWD TQ:

1. With the power disconnected from the drive, connect a DC ammeter in series with the armature.
2. Set the FWD TQ trim pot to minimum (full CCW).
3. Set the speed adjust potentiometer to maximum forward speed (full CW).
4. Carefully lock the motor armature. Be sure that the motor is firmly mounted.
5. Apply line power. The motor should be stopped.
6. Slowly adjust the FWD TQ trim pot CW until the armature current is 150% of motor rated armature current.
7. Turn the speed adjust potentiometer to minimum speed (full CCW).
8. Remove line power.
9. Remove the stall from the motor.
10. Remove the ammeter in series with the motor armature if it is no longer needed.

To calibrate the REV TQ:

1. Follow the steps for calibrating the forward torque using the REV TQ trim pot and with the motor set to run in the reverse direction.

IR Compensation (IR COMP): The IR COMP setting determines the degree to which motor speed is held constant as the motor load changes. It is factory set for optimum motor regulation. To calibrate the IR COMP:

1. Set the IR COMP trim pot full CCW.
2. Increase the speed adjust potentiometer until the motor runs at midspeed without load. A handheld tachometer may be used to measure motor speed.
3. Load the motor armature to its full load armature current rating. The motor should slow down.
4. While keeping the load on the motor, rotate the IR COMP trim pot until the motor runs at the speed measured in step 2. If the motor oscillates (overcompensation), the IR COMP trim pot may be set too high (CW). Turn the IR COMP trim pot CCW to stabilize the motor.
5. Unload the motor.

Forward Acceleration (FWD ACC): The FWD ACC setting determines the time the motor takes to ramp to a higher speed in the forward direction or to a lower speed in the reverse direction. To calibrate the FWD ACC, turn the FWD ACC trim pot CW to increase the forward acceleration time, and CCW to decrease the forward acceleration time.

Reverse Acceleration (REV ACC): The REV ACC setting determines the time the motor takes to ramp to a higher speed in the reverse direction or to a lower speed in the forward direction. To calibrate the REV ACC, turn the REV ACC trim pot CW to increase the reverse acceleration time, and CCW to decrease the reverse acceleration time.



Tachogenerator Feedback (TACH): The TACH setting, like IR COMP setting, determines the degree to which motor speed is held constant as the motor load changes. To calibrate the TACH trim pot:

1. Connect the tachogenerator to T1 and T2. The polarity is positive (+) for T1 and negative (-) for T2 when the motor is running in the forward direction.
 2. Set the feedback select switch SW503 to ARM for armature feedback.
 3. Set the speed adjust potentiometer or input voltage or current signal to maximum speed. Measure the armature voltage across A1 and A2 using a voltmeter.
 4. Set the speed adjust potentiometer or input voltage or current signal to zero speed.
 5. Set SW503 to TACH for tachogenerator feedback.
 6. Set the IR COMP trim pot to full CCW.
 7. Set the TACH VOLTS trim pot to full CW.
 8. Set the speed adjust potentiometer or input voltage or current signal to maximum speed.
 9. Adjust the TACH VOLTS trim pot until the armature voltage is the same value as the voltage measured in step 3.
- Check that the TACH VOLTS is properly calibrated. The motor should run at the same set speed when SW503 is set to either ARM or TACH.

Deadband (DB): The deadband trim pot determines the time that will elapse between the application of current in one direction before current is applied in the opposite direction. The deadband trim pot affects the resistance that a motor has to changes in shaft position at zero speed. It does this by applying an AC voltage to the motor armature. Deadband is factory calibrated to approximately the 3 o'clock position for 60 Hz AC line operation. Recalibrate the deadband to the 9 o'clock position for 50 Hz operation. If you hear motor noise (humming), the deadband might be set too high. Turn the deadband trim pot CCW until the motor noise ceases.

Operation

POTENTIOMETER AND SIGNAL INPUT WIRING

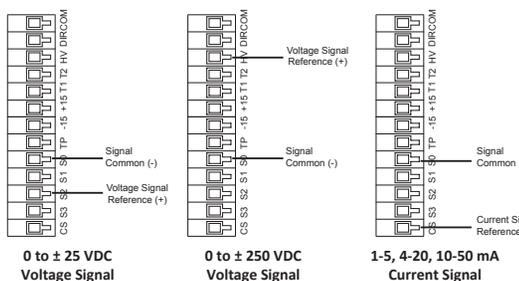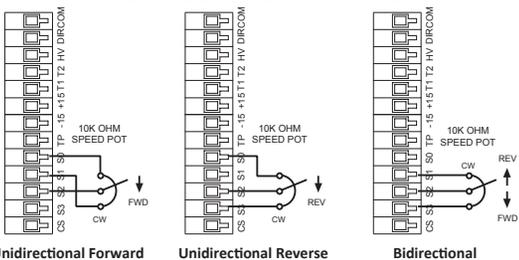

No part of this document may be reproduced or retransmitted in any form without written permission from American Control Electronics®. The information and technical data in this document are subject to change without notice. American Control Electronics® makes no warranty of any kind with respect to this material, including, but not limited to, the implied warranties of its merchantability and fitness for a given purpose. American Control Electronics® assumes no responsibility for any errors that may appear in this document and makes no commitment to update or to keep current the information in this document.